

#16-NA-042: Infotainment System Upgrade for Android Auto Feature - (Mar 2, 2016)

Subject: Infotainment System Upgrade for Android Auto Feature



Attention: This Bulletin also applies to any of the Models that may be Export vehicles.


Brand:	Model:	Model Year:		VIN:		Additional Options:
		from	to	from	to	
Buick Cadillac Chevrolet GMC	All Passenger Cars and Trucks (Excluding Buick Envision and Cadillac SRX)	2016	2016	June 1, 2015	April 4, 2016	Equipped with Radio RPO I05 or I06

<p>Condition</p>	<p>© 2016 General Motors. All rights reserved.</p> <p>This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership with the coupon that was mailed to them from General Motors.</p> <p>GM is offering an infotainment system upgrade for vehicles built with I05 and I06 to include the Android Auto Feature.</p>
<p>Additional Options</p>	<p>Equipped with I05 or I06</p>


What is Android Auto ?

Android Auto compatibility is a simple and smart way to use your Android smartphone in the car. One of the new Phone Integration features available on select MyLink/IntelliLink/CUE infotainment systems, Android Auto enables Android smartphone users to display certain apps and functionality from their phone on the vehicle's infotainment display, allowing them to control those apps and functions via the vehicle's infotainment system touchscreen or voice commands.


Key Features of Android Auto

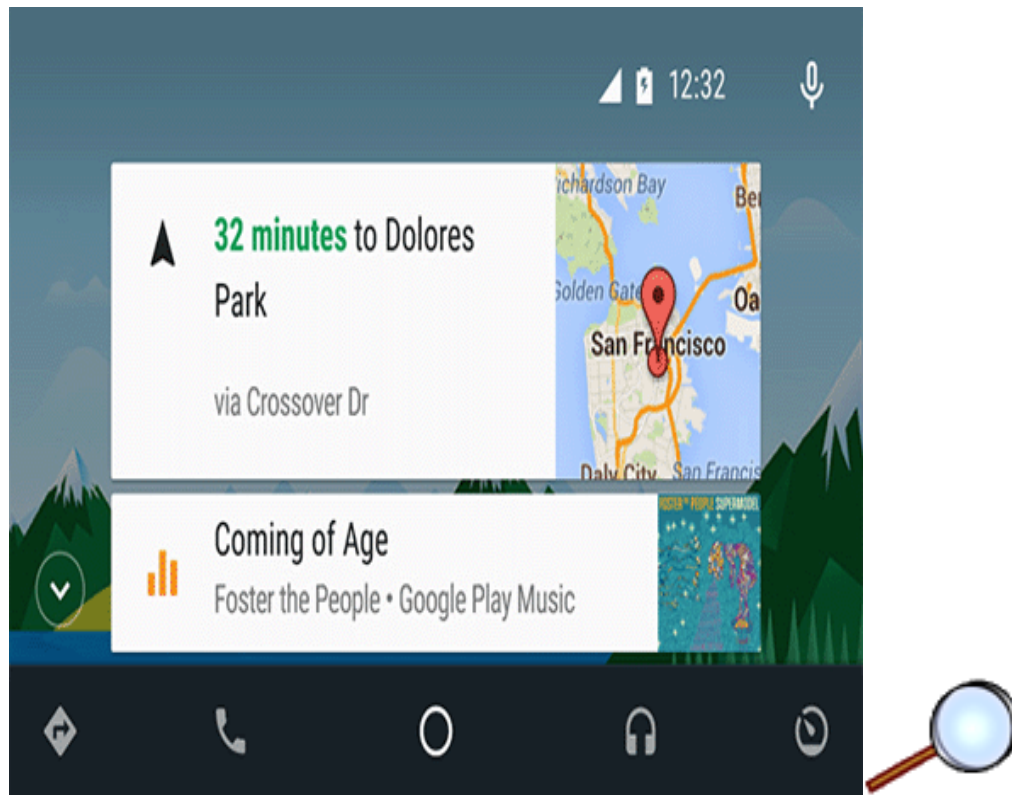


- Home Screen: Android Auto automatically brings you useful information, and organizes it into simple cards that appear just when they're needed.

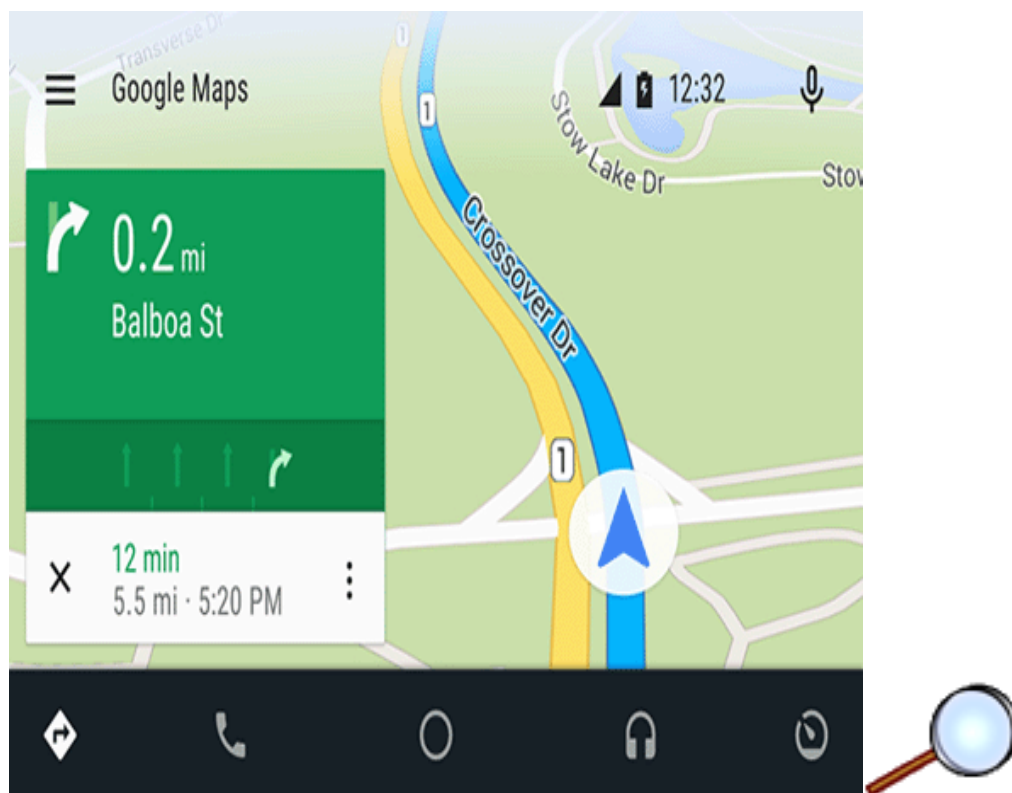

- Maps: Let Google Maps lead the way. It's easy to get where you're going with free voice-guided navigation, live traffic information, lane guidance, and more.

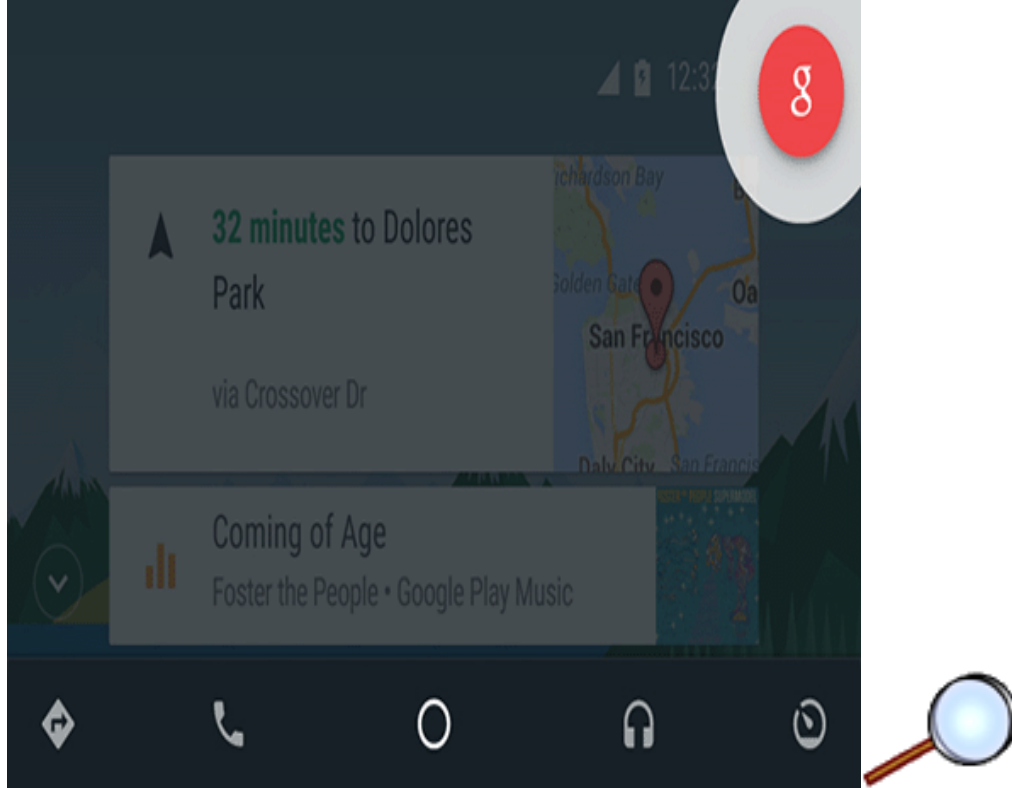

- Voice: Just say the word – Best-in-class speech technology makes controlling everything with your voice fast and easy. Send, read, and reply to your text messages; Make calls, return missed calls, and listen to voicemail – Talk to Google can help you do all these things, and more.

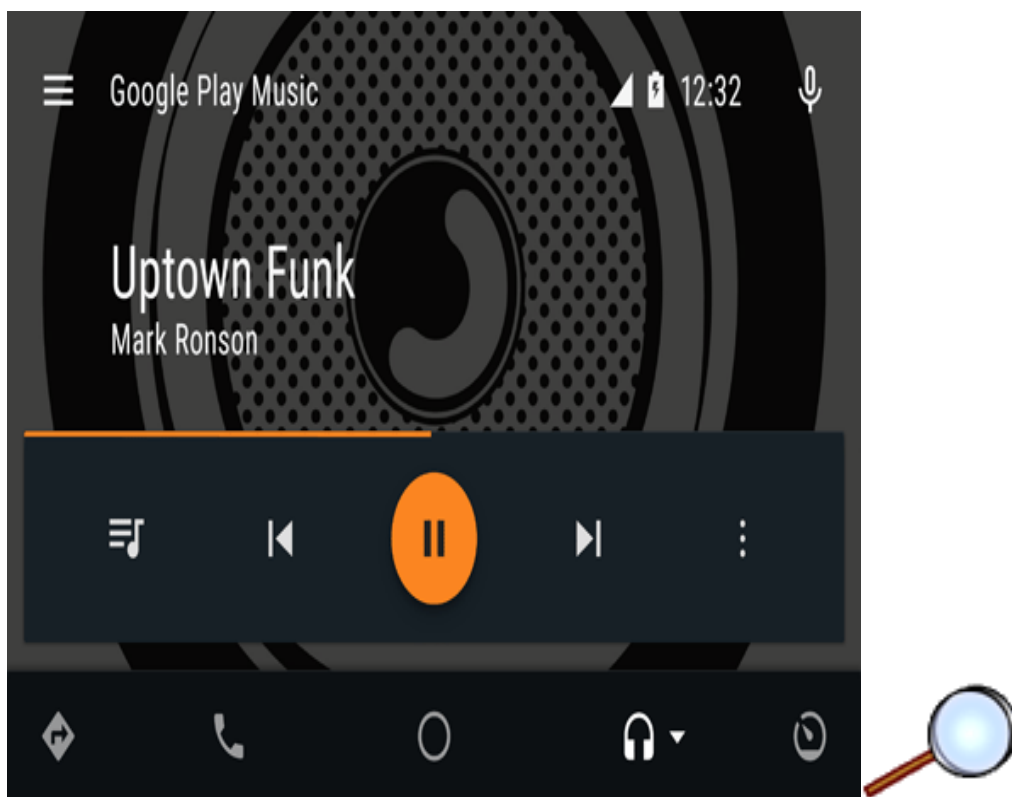

- Music: Your favorite tunes – to go! Access and stream over 30 million songs, custom playlists and more with Google Play Music.

[Dealer Inventory Upgrade](#)

For vehicles that are in Dealer stock or may be in-transit from the plant, Dealers should update all units as part of the PDI process and submit for addition labor time.

Note:

- DO NOT program a control module unless directed to by a service procedure or a service bulletin. If the control module is not properly configured with the correct calibration software, the control module will not control all of the vehicle features properly.
- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming,

programming failure or control module damage may occur.

- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install the *EL-49642* SPS Programming Support Tool to maintain system voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, radio, etc.
- During the programming procedure, follow the SPS prompts for the correct ignition switch position.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

These units should be updated before being sold to customers. No communications will be going out to customers that purchase a vehicle which is eligible for the upgrade, after March 1, 2016.

Important: No VCI number is needed for adding Android Auto, and no call to TCSC is needed.

To program an existing control module, perform the following procedure:

Note: The vehicle must remain in PARK during the programming procedure.

1. Install the *EL-49642* SPS Programming Support Tool.

Note: If using a pre-configured USB drive supplied by General Motors, proceed to step 6.

2. Connect a USB drive to the computer.
3. Access the Service Programming System (SPS) and follow the on-screen instructions.
4. On the SPS Supported Controllers screen, select K74 Human Machine Interface Control Module – USB Copy/ USB File Transfer.

Note:

If there are no files available for USB transfer via SPS, proceed to step 10.

Software currently loaded on the USB Drive will be verified and if files are incorrect they will be deleted and correct files will be loaded. If files residing on the USB Drive are correct for the vehicle being serviced, the Techline terminal will not delete those files and allow the drive to be re-used.

5. Upon completion of the file transfer, remove the USB drive from the computer.
6. Ignition ON, infotainment system ON.

Note: The HMI will not allow the installation of the same software version via USB. If the same software is detected the installation process will not start.

7. Connect the USB drive to the USB port in the vehicle.
8. The infotainment system will recognize that update files are available. Follow the infotainment display on-screen instructions and select Update when prompted. Programming will take several minutes.
9. Upon completion of programming, remove the USB drive. Follow the infotainment display on-screen instructions.
10. Access the Service Programming System (SPS) and follow the on-screen instructions.
11. On the SPS Supported Controllers screen, select K74 Human Machine Interface Control Module – Programming and follow the on-screen instructions.
12. At the end of programming, choose the “Clear DTCs” function on the SPS screen.
13. Ignition OFF, Retained Accessory Power (RAP) OFF, remove the key fob from range of the vehicle, and let the vehicle sit for five minutes. Retest system operation to verify the repair.

A flat fee reimbursement has been established and Dealers should submit for reimbursement for all stock vehicles that are updated.

In addition to PDI, there is a special Labor op Code set up for Dealers to submit for the additional \$10 reimbursement on stock units.

Labor Operation	Description	Labor Time
0600174*	Android Software Upgrade – PDI	0.0 hr
*This is a unique Labor Operation for Bulletin use only. Submit using a ZPDI transaction with a \$10.00 net.		

Customer Vehicle Upgrade

For customer vehicles, reprogram the vehicles HMI Module with the latest software.

Note:

- DO NOT program a control module unless directed to by a service procedure or a service bulletin. If the control module is not properly configured with the correct calibration software, the control module will not control all of the vehicle features properly.
- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install the *EL-49642* SPS Programming Support Tool to maintain system voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, radio, etc.
- During the programming procedure, follow the SPS prompts for the correct ignition switch position.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

Important: No VCI number is needed for adding Android Auto, and no call to TCSC is needed.

To program an existing control module, perform the following procedure:

Note: The vehicle must remain in PARK during the programming procedure.

1. Install the *EL-49642* SPS Programming Support Tool.

Note: If using a pre-configured USB drive supplied by General Motors, proceed to step 6.

2. Connect a USB drive to the computer.

3. Access the Service Programming System (SPS) and follow the on-screen instructions.

4. On the SPS Supported Controllers screen, select K74 Human Machine Interface Control Module – USB Copy/ USB File Transfer.

Note:

If there are no files available for USB transfer via SPS, proceed to step 10.

Software currently loaded on the USB Drive will be verified and if files are incorrect they will be deleted and correct files will be loaded. If files residing on the USB Drive are correct for the vehicle being serviced, the Techline terminal will not delete those files

and allow the drive to be re-used.

5. Upon completion of the file transfer, remove the USB drive from the computer.
6. Ignition ON, infotainment system ON.
 - Note:** The HMI will not allow the installation of the same software version via USB. If the same software is detected the installation process will not start.
7. Connect the USB drive to the USB port in the vehicle.
8. The infotainment system will recognize that update files are available. Follow the infotainment display on-screen instructions and select Update when prompted. Programming will take several minutes.
9. Upon completion of programming, remove the USB drive. Follow the infotainment display on-screen instructions.
10. Access the Service Programming System (SPS) and follow the on-screen instructions.
11. On the SPS Supported Controllers screen, select K74 Human Machine Interface Control Module – Programming and follow the on-screen instructions.
12. At the end of programming, choose the “Clear DTCs” function on the SPS screen.
13. Ignition OFF, Retained Accessory Power (RAP) OFF, remove the key fob from range of the vehicle, and let the vehicle sit for five minutes. Retest system operation to verify the repair.

Warranty Information for Customer Vehicle Upgrade

Labor Operation	Description	Labor Time
0600355*	Android Software Upgrade – Chevrolet	0.4 hr
0600365*	Android Software Upgrade – Buick	0.4 hr
0600375*	Android Software Upgrade – GMC	0.4 hr
0600385*	Android Software Upgrade – Cadillac	0.4 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION