



Instrument Panel Upper Trim Panel Cover Replacement

Removal Procedure

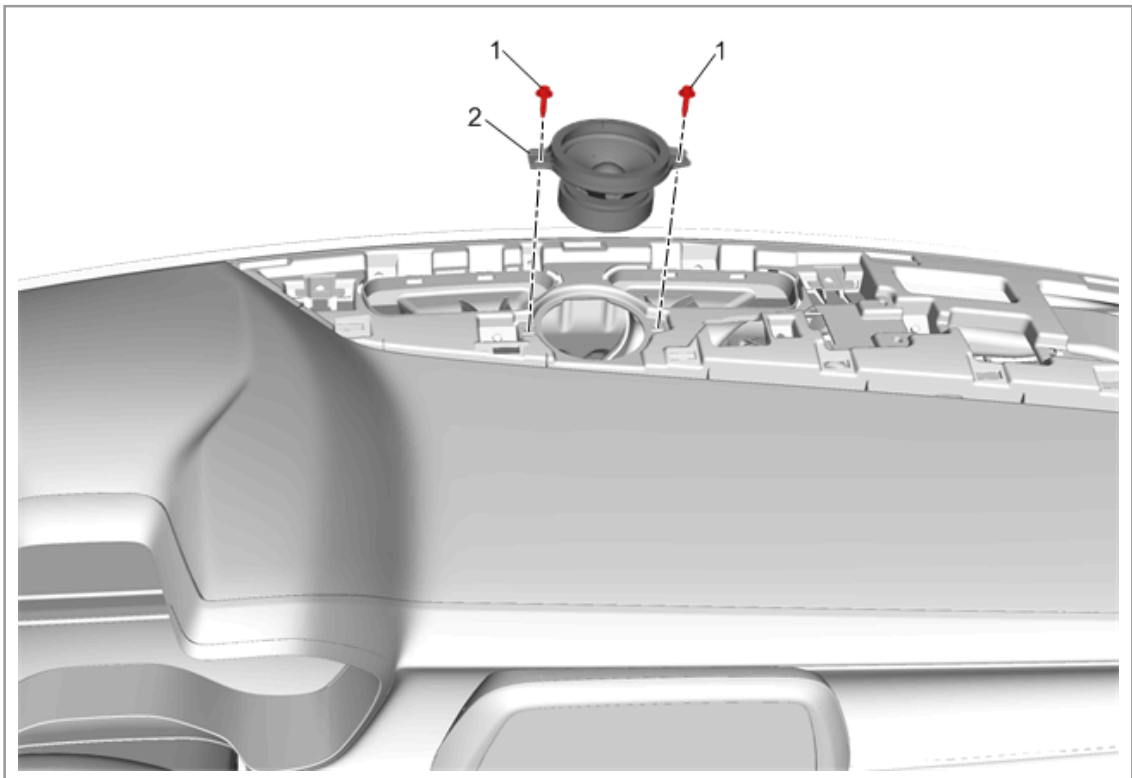


1. Radio Front Center Speaker Replacement(2) >> Remove

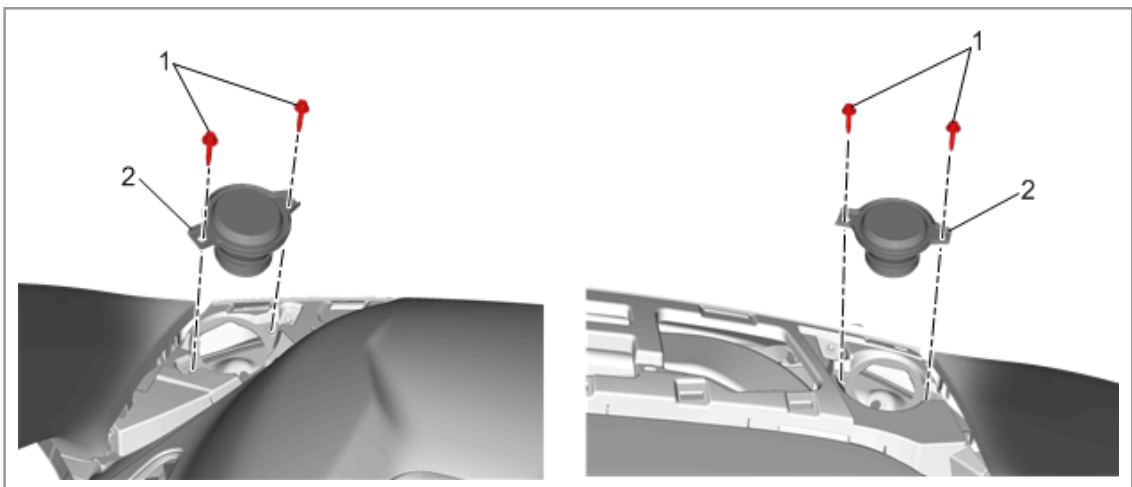


2. Radio Front Speaker Replacement(2) >> Remove

Provided By Par-Tech, Inc. (<http://www.partechgss.com>) ^

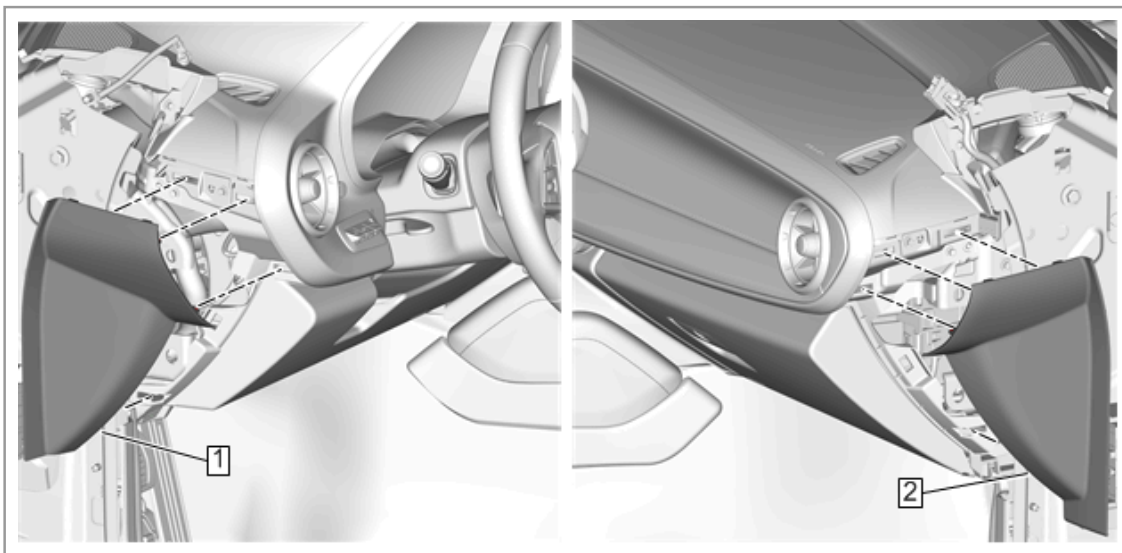


3. Instrument Panel Outer Trim Cover Replacement(1) >> Remove

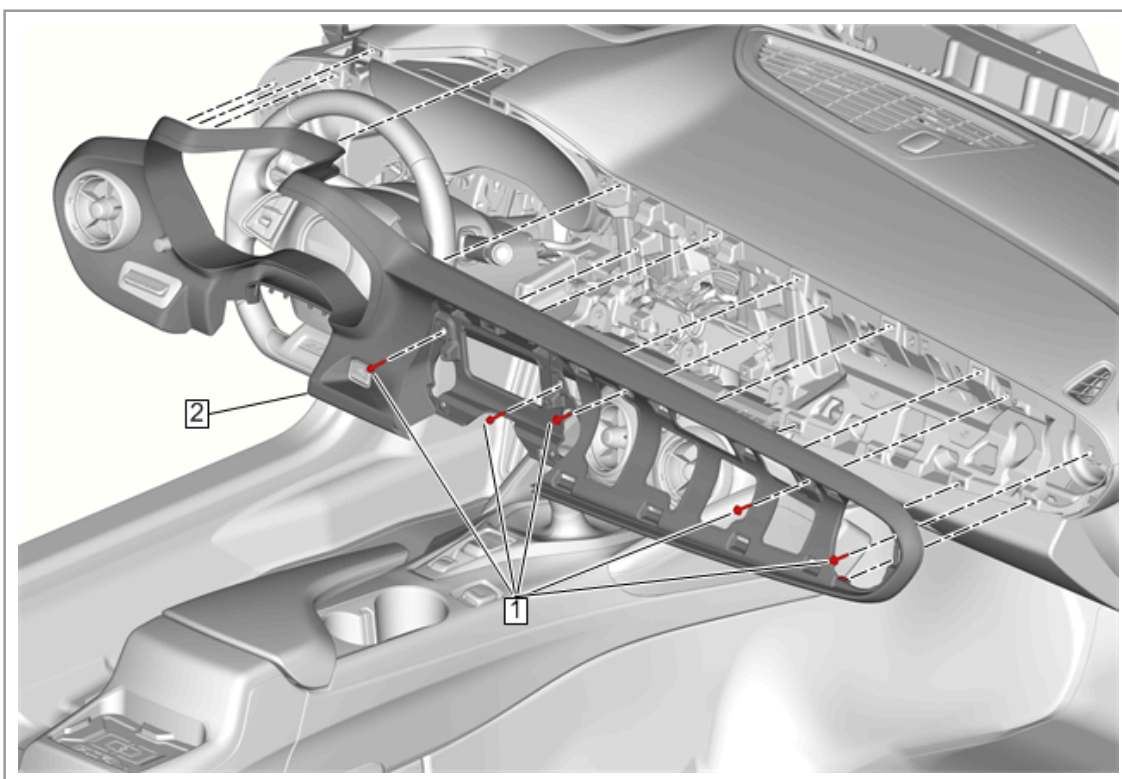


4. Instrument Panel Cluster Trim Plate Replacement(2) >> Remove



5. Instrument Panel Compartment Replacement(2) >> Remove

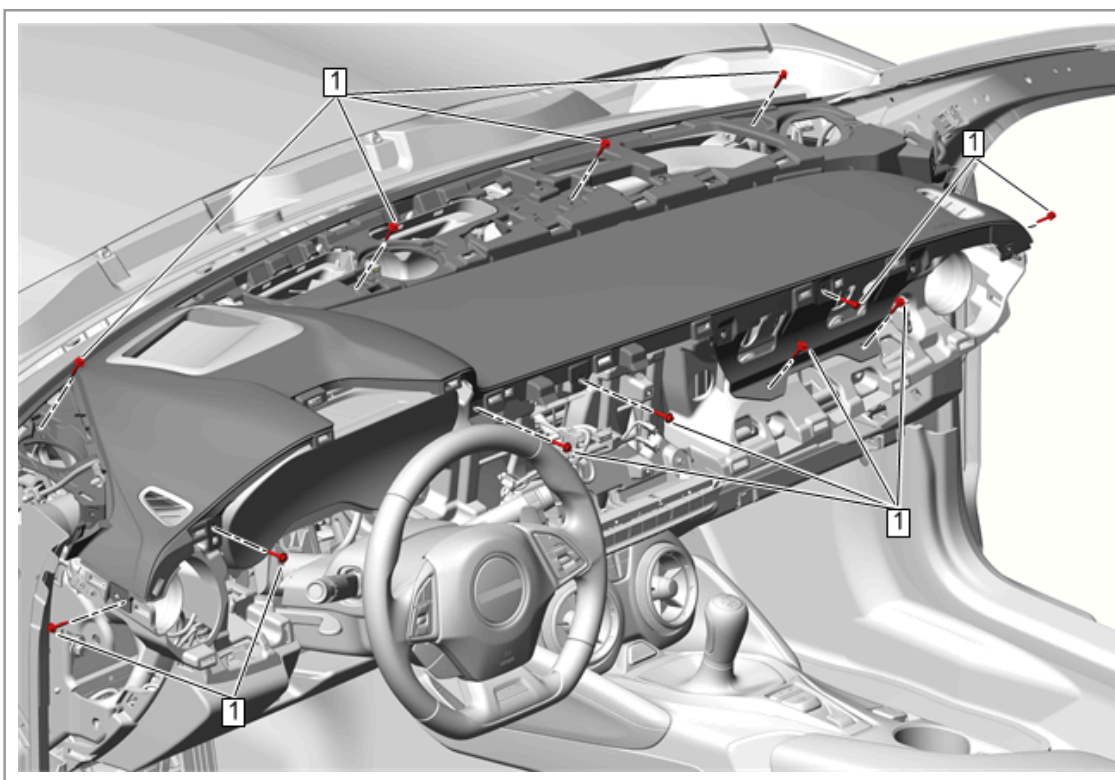


6. Instrument Panel Bolt (1) >> Remove [12x]

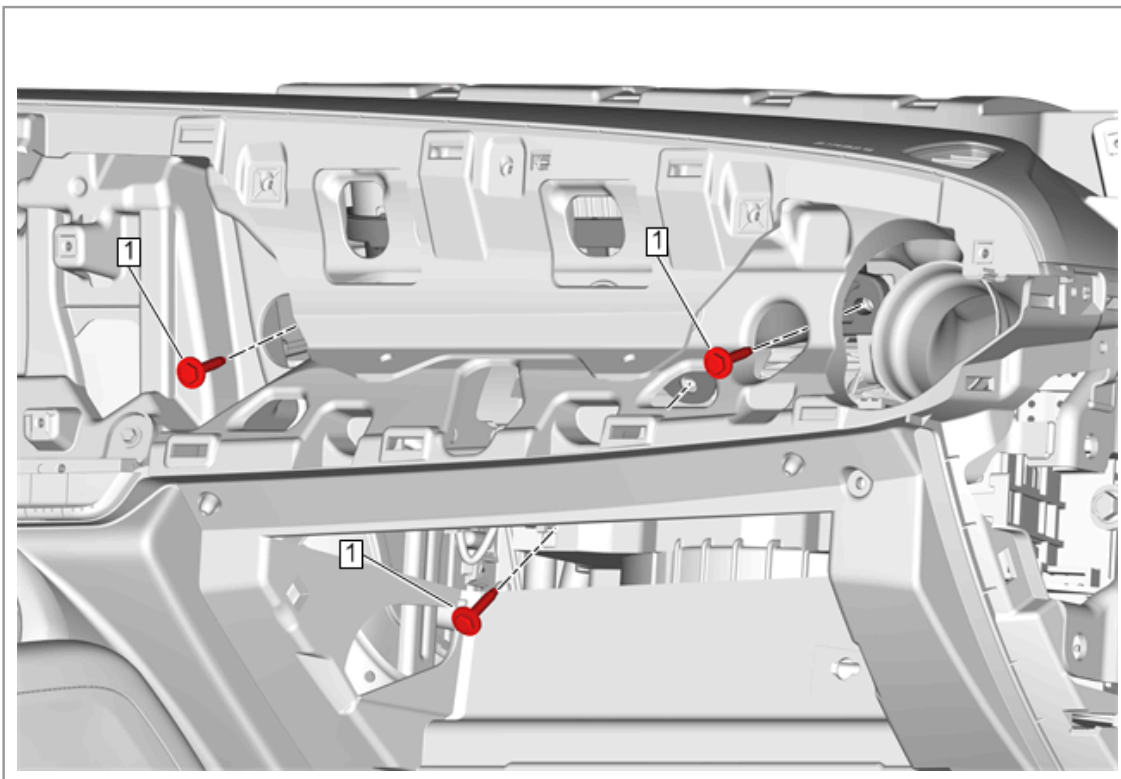

7. Instrument Panel Airbag Bolt (1) >> Remove [3x]


8. Disconnect the electrical connector.

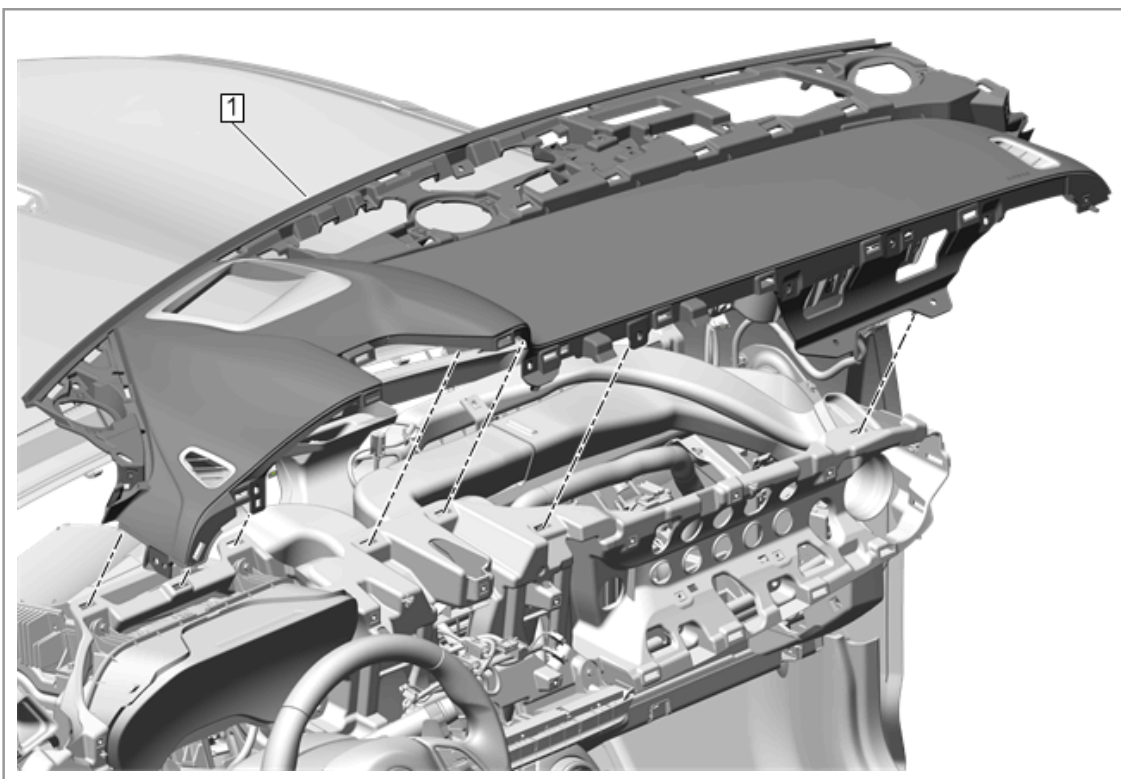


9. Instrument Panel Upper Trim Panel Cover (1) >> Remove

10. Disconnect and reposition harness as necessary.
11. With the aid of an assistant, remove the instrument panel upper trim panel cover from the vehicle.(1)
12. Transfer components as necessary.

Installation Procedure

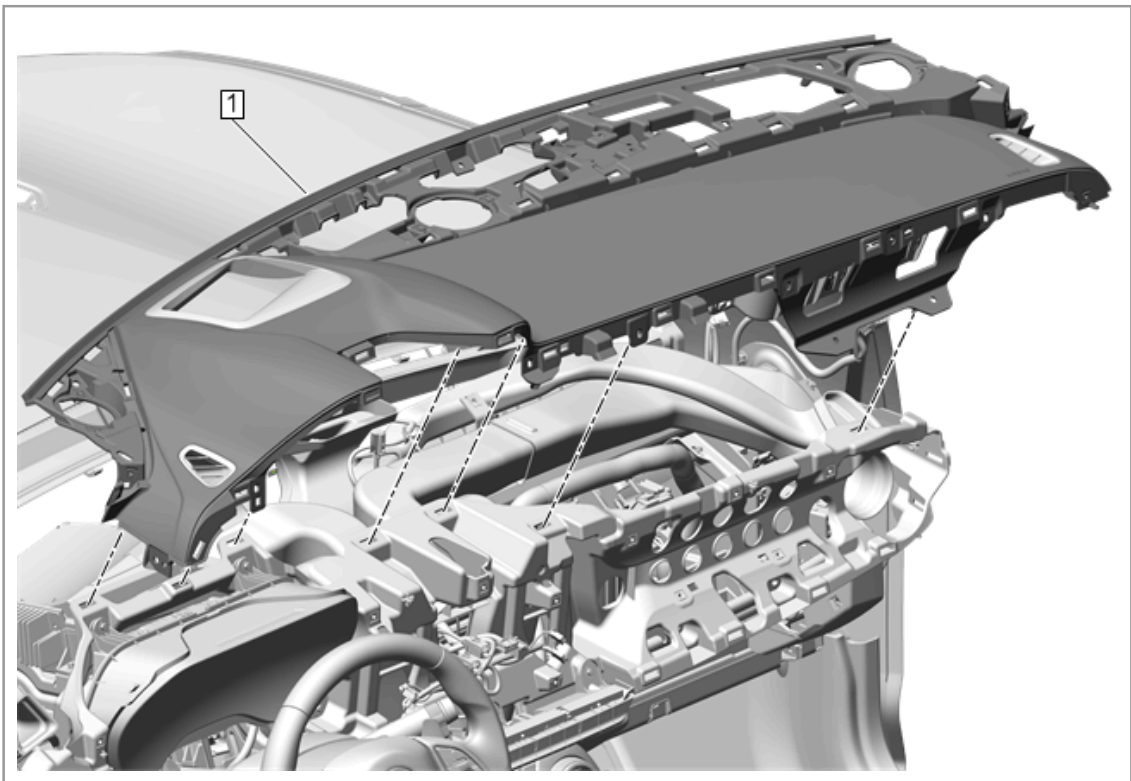


1. With the aid of an assistant, position the instrument panel upper trim panel cover into the vehicle. (1)

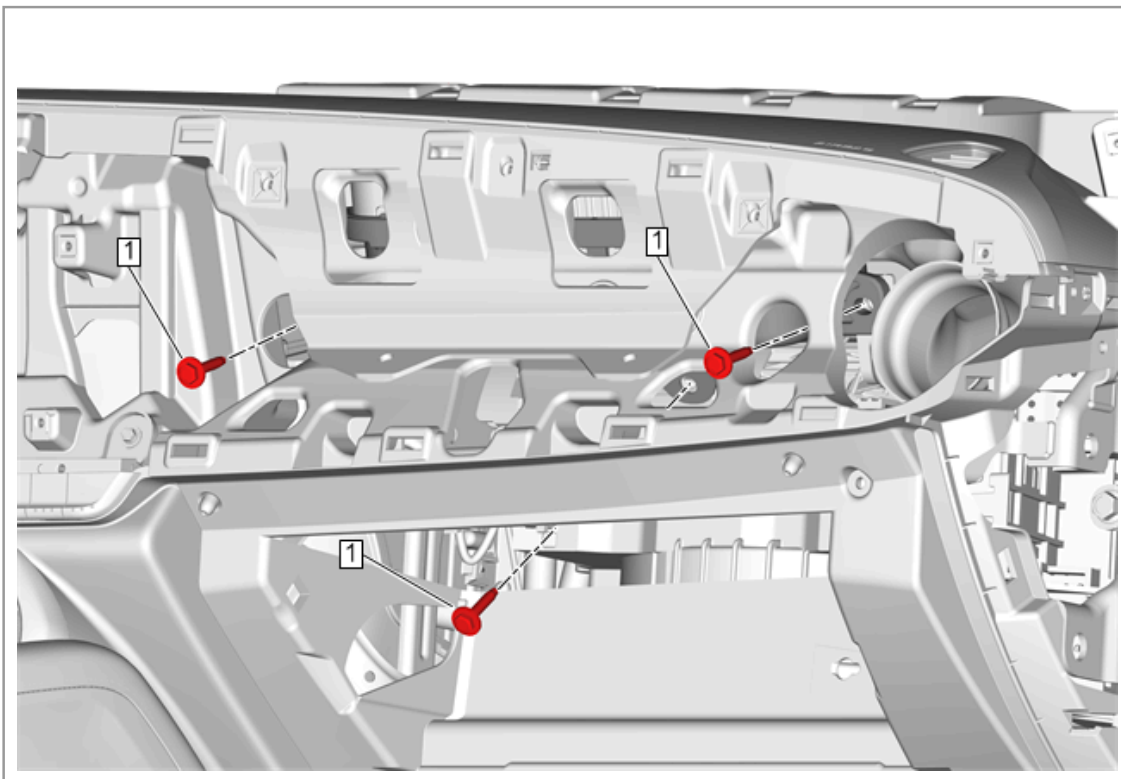

Caution: Refer to Fastener Caution.


2. Instrument Panel Airbag Bolt (1) >> Install and tighten [3x] 9 N-m (80 lb in)
3. Connect the electrical connector.

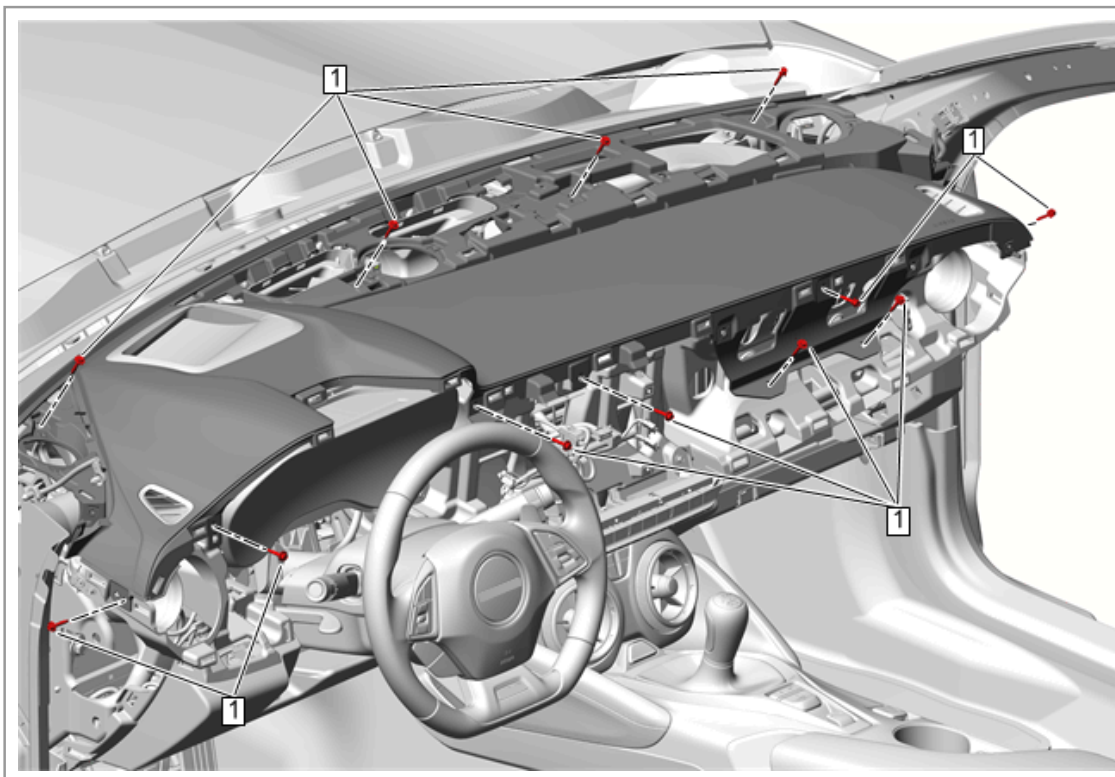


4. Instrument Panel Bolt (1) >> Install and tighten 2.5 N-m (22 lb in)




5. Instrument Panel Compartment Replacement(2) >> Install

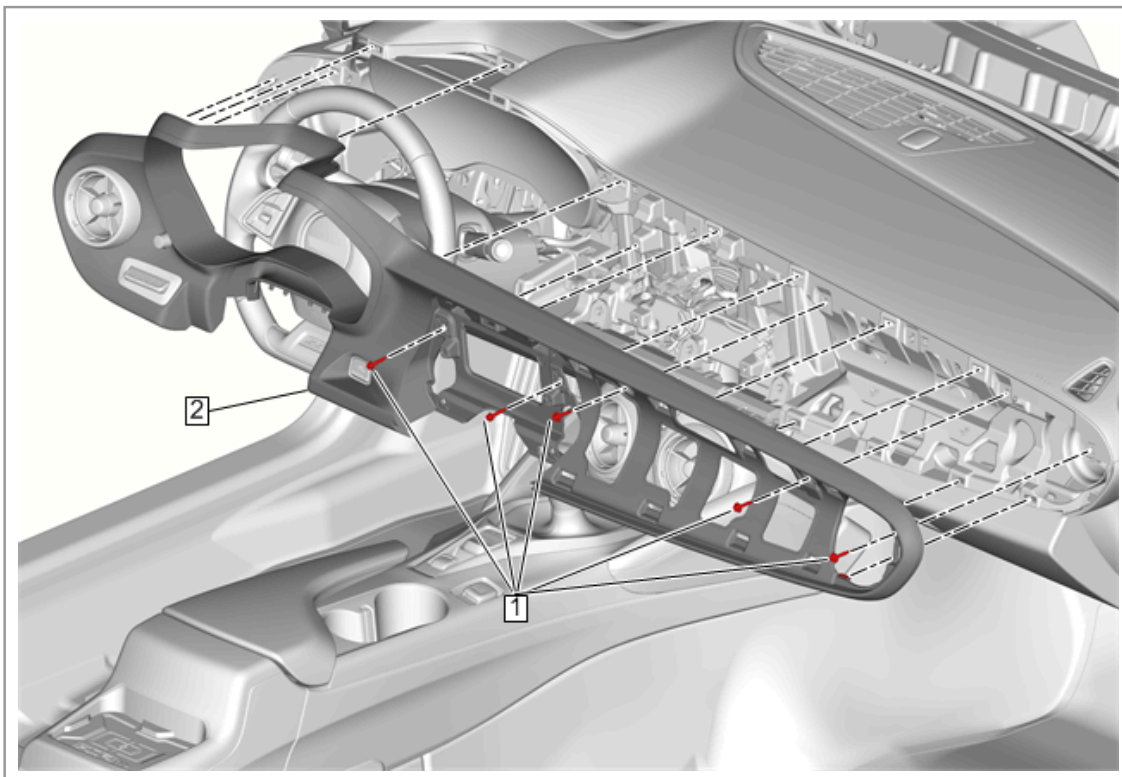


6. Instrument Panel Cluster Trim Plate Replacement(2) >> Install

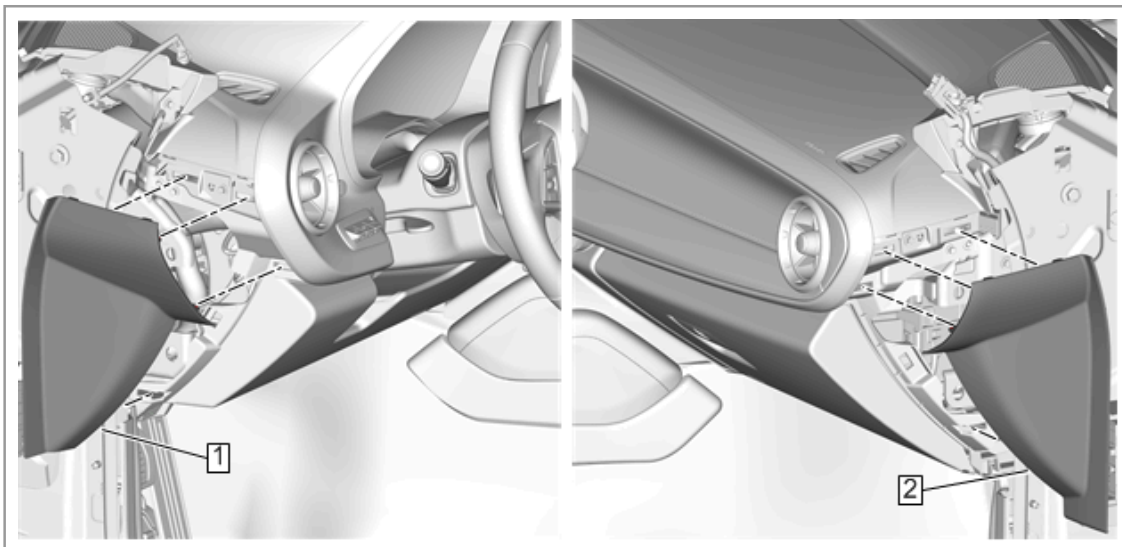

7. Instrument Panel Outer Trim Cover Replacement(1) >> Install

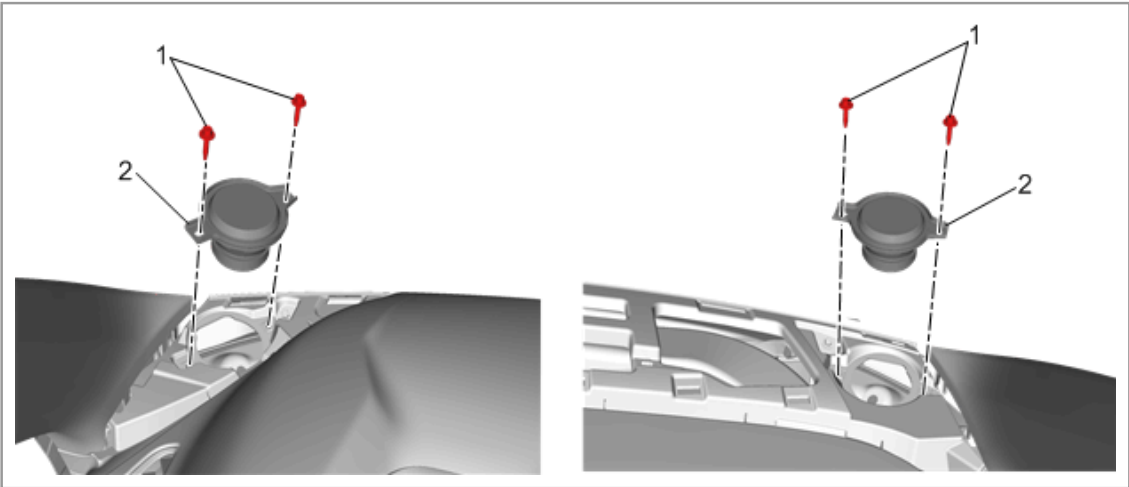

8. Radio Front Speaker Replacement(2) >> Install

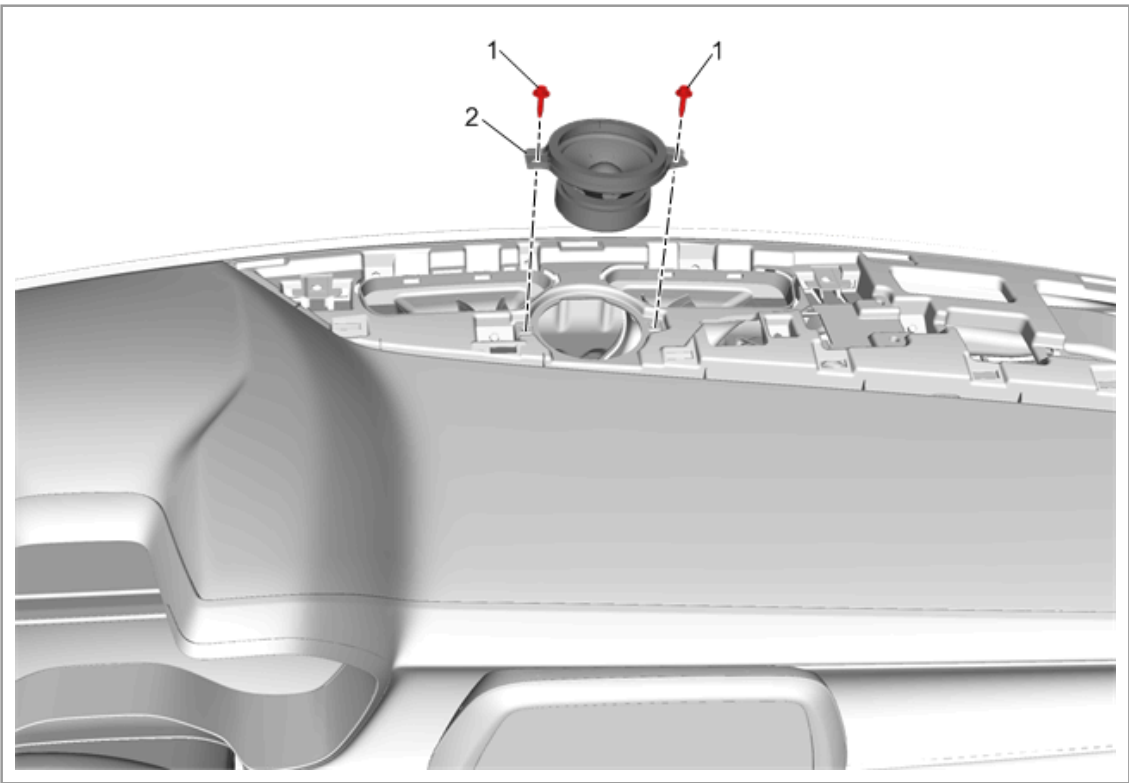

9. Radio Front Center Speaker Replacement(2) >> Install

Related Part Information

Part Name	Catalog Name	Part Code
Instrument Panel Upper Trim Panel Cover	COVER,I/P UPR T/PNL	1003A
Instrument Panel Upper Trim Panel Cover	COVER,I/P UPR T/PNL	1003B

